



AEROPILOT Ltd.

LEGEND

RELEASE DATE: 30.01.2020

EFFECTIVE DATE: 30.01.2020

NOTICE ID: 2006

SERVICE BULLETIN NO. 2006

SUBJECT:

Checking the release of the rocket parachute rescue system

AFFECTED PRODUCTS:

Legend 540 and Legend 600

COMPLIANCE:

Mandatory

INSTRUCTIONS:

During the inspection, a gross error was found in the installation of the parachute rescue system – the unlocking (unscrewing) of the screw securing the rocket (transport fuse), see the attached photos.

Control procedure:

1. Pull the seat forward and remove it from the fuselage.
2. Remove the L-shaped laminate cover behind the seats.
3. The locking screw must be removed on the left side in the direction of flight at the bottom of the rocket. At the same time, check that the wire fuse with the red flag is removed at the top of the rocket.
4. After removing both fuses, you can put the cover and continue to operate the aircraft. Otherwise, inform the manufacturer Aeropilot s.r.o.




Both fuses have to be removed.



Remove the cover.



Removed fuse

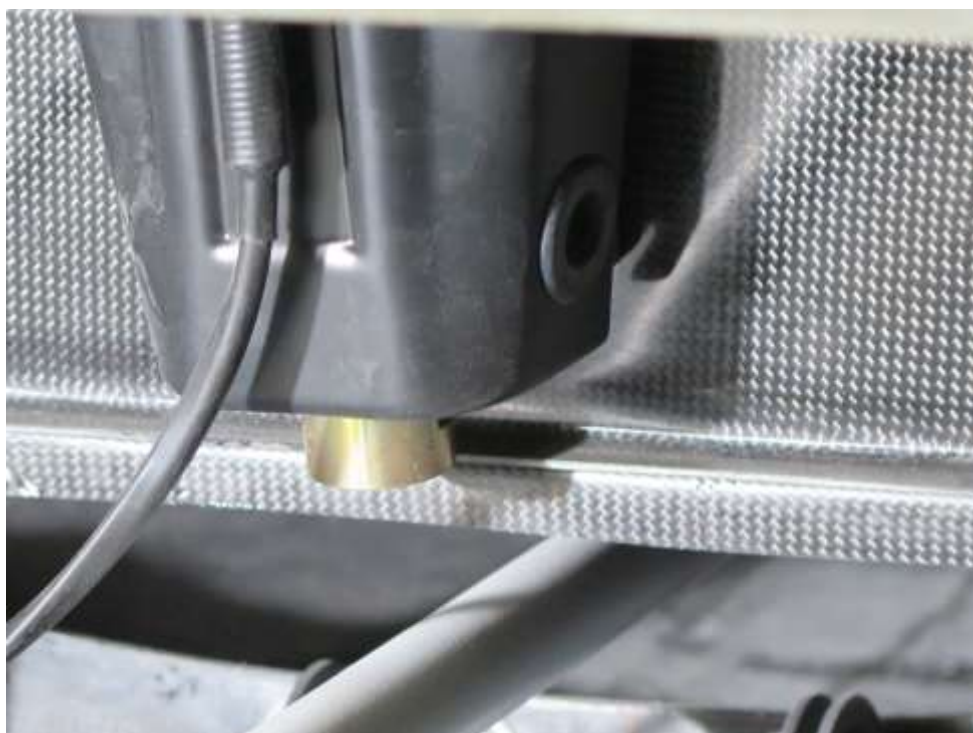

Removed fuse