

## **SERVICE BULLETIN**

### **SUBJECT:**

Check of release of the rocket rescue system

### **AFFECTED PRODUCTS:**

Legend 540 and Legend 600

### **COMPLIANCE:**

MANDATORY

### **INSTRUCTIONS:**


During the revision a gross error in the installation of the parachute rescue system was found, unlocking (unscrewing) the bolt securing the rocket (transport safety), see the attached photo.

Control procedure:

- 1) Pull the seat forward and remove it from the fuselage
- 2) Remove the L-shaped laminate cover behind the seats
- 3) Shine inside under the trunk and the locking screw has to be removed in the left side in the flight direction at the bottom of the rocket. At the same time, check that a wire fuse with a red flag is removed at the top of the rocket.
- 4) When both fuses are removed, you can mount the cover and continue to operate the airplane. Otherwise, inform the manufacturer Aeropilot s.r.o., Jeníkovská 1815, Čáslav, Czech Republic. Tel.: +420 605 296 563, info@aeropilotcz.com.




Both fuses have to be removed

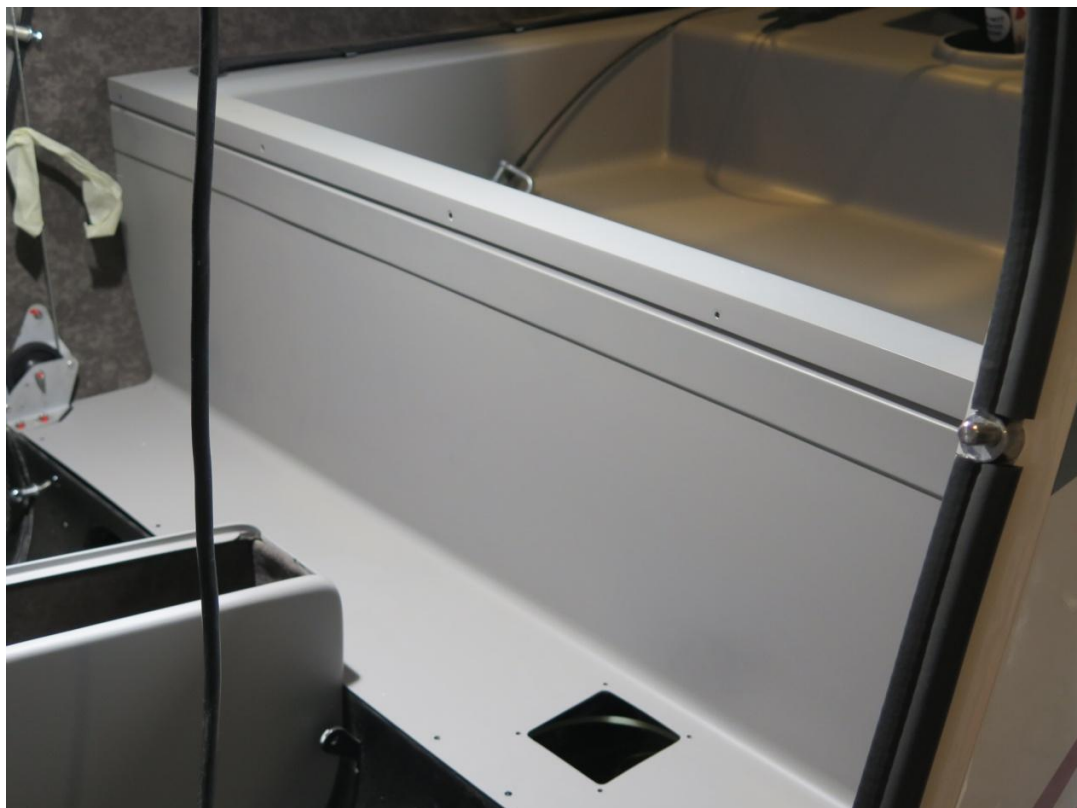

Remove the cover



Removed fuse

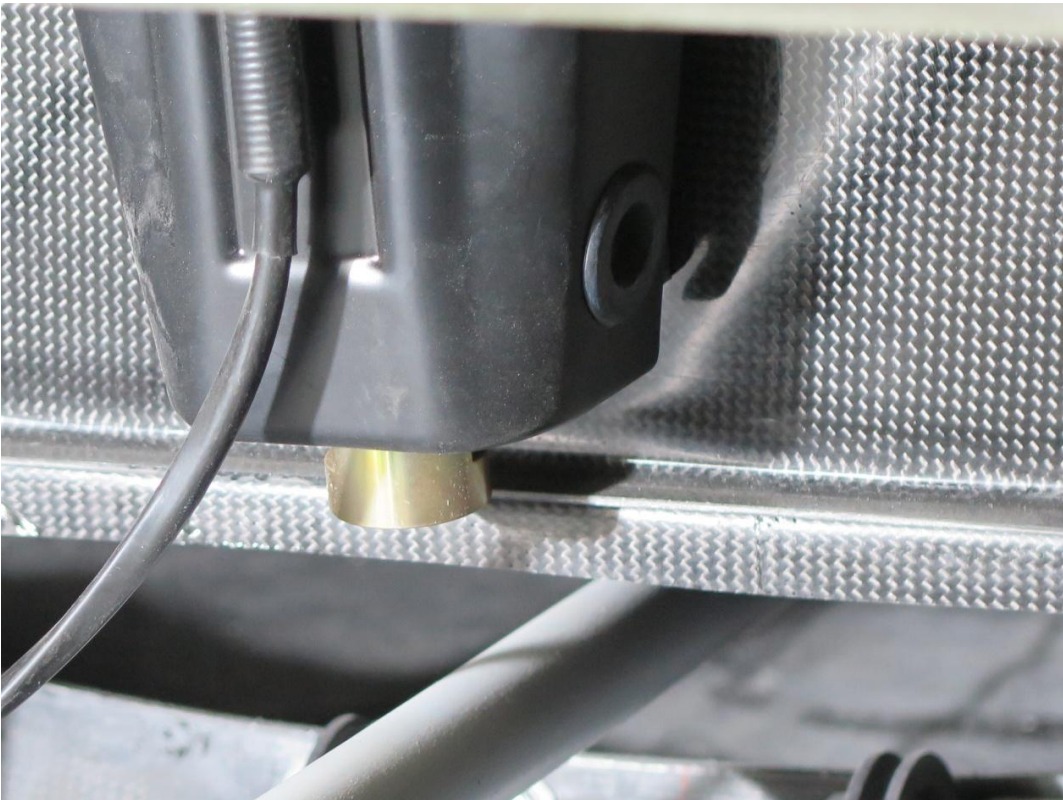

Removed fuse